

Sick Bike Parts.com

Throttle and cable installation instructions


1. Remove the clear cover from the top of the throttle housing and carefully remove the red pulley.



2. Remove the outer cover from the throttle housing.



3. Insert the large cable end through the adjuster hole.

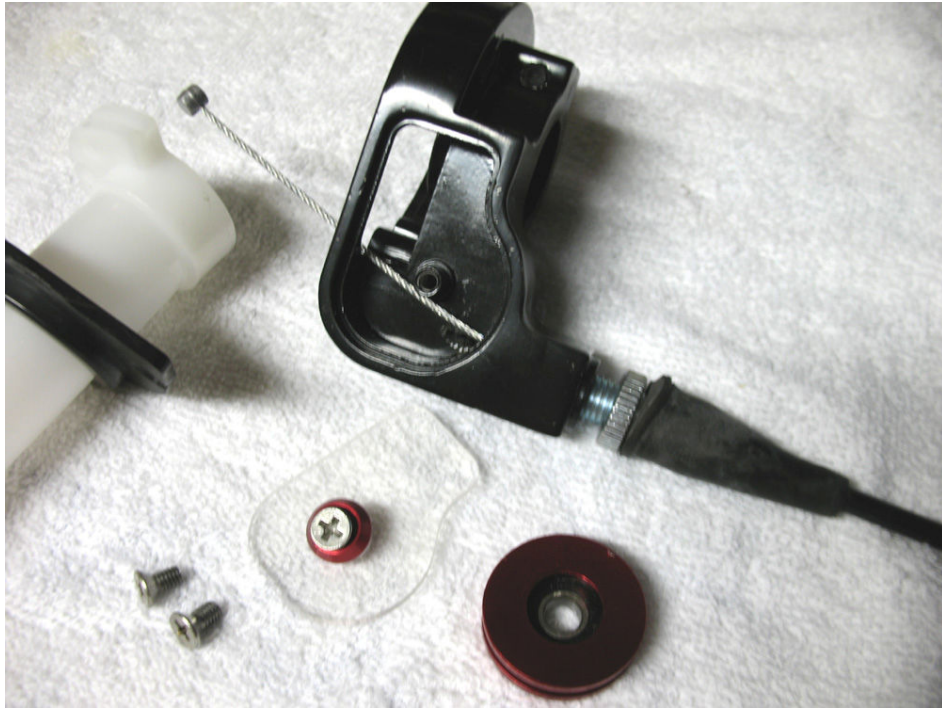

4. Insert the cable end into the slot on the throttle sleeve. For CNS and 4 Stroke Carbs use the back hole and for NT Carbs use the one as shown in the photo.



5. Attach the outer plate back onto the throttle housing. Then slide the cable into the slot on the pulley and place the pulley back onto the pivot pin.



6. Reinstall the clear cover back onto the throttle housing.
7. Screw the cable adjuster into the throttle housing.
8. Check your handle bars for any debris or burrs that could keep the throttle sleeve from rotating freely.
9. Apply some light oil to your bars and slide the throttle assembly on.
10. Adjust the throttle assembly onto your bars such that the throttle sleeve does not hit the end of your handle bars.
11. Secure the throttle assembly to your bars by tightening the clamp on the housing.
12. Rout the throttle cable cleanly back to your carburetor ensuring there are no tight bends or kinks and attach to your carburetor.
13. Adjust the slack in the cable by using a combination of the adjuster at the throttle assembly and the carburetor. Ensure there is enough free play in the cable that the slide in the carburetor will seat properly onto the idle adjustment screw.